OMB Control No.: 2127-0004

Part 573 Safety Recall Report

19V-087

Manufacturer Name: KTM North America, Inc.

NHTSA Recall No.: 19V-087

Manufacturer Recall No.: TB1904



Manufacturer Information:

Manufacturer Name: KTM North America, Inc.

Address: 1119 Milan Avenue

Amherst OH 44001

Company phone: 440-985-3553

Population:

Number of potentially involved: 1,588 Estimated percentage with defect: 2 %

Vehicle Information:

Vehicle 1: 2015-2016 KTM 1290 Super Adventure

Vehicle Type: MOTORCYCLES

Body Style :

Power Train: GAS

Descriptive Information: - The component was only used only on KTM 1290 Super Adventure models.

- Affected units were manufactured between December 1, 2014 and March 10, 2016.

- The component parts manufactured with a date badge on or after February 2016 are

not affected.

- Total units manufactured 1588.

- Less than 2% of affected units have reported issues.

Production Dates: DEC 01, 2014 - MAR 10, 2016

VIN Range 1: Begin: VBKV59406FM918535 End: VBKV5940XGM945108 ✓ Not sequential

Description of Defect:

Description of the Defect: On affected motorcycles, during operation or while sitting still, it is possible

that fuel can seep or leak out of the fuel tank cover mounting insert area of the

fuel tank.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: During operation or while sitting still, this occurrence may increase the risk

of injury and/or damage to the rider and/or property.

Description of the Cause: During the manufacturing process, molded material did not reach optimal

temperature, resulting in unbalanced distribution of materials around the

threaded insert.

Identification of Any Warning During operation or while sitting still, this occurrence may increase the risk of

that can Occur: injury and/or damage to the rider and/or property. The rider may observe and

smell fuel on or near the tank.

Supplier Identification:

Component Manufacturer

Name: Elkamet Kunststofftechnik GmbH

Address: Georg-Kramer-Straße 3

Biedenkopf FOREIGN STATES D-35216

Country: Germany

Chronology:

On November 16, 2017 KTM Sportmotorcycle GmbH (the Austrian vehicle manufacturer) contacted the Supplier of the 1290 Super Adventure fuel tanks regarding customer service claims of fuel tank leakage reports on Model Year 2015 and 2016 vehicles. Elkamet Kunststofftechnik GmbH (the Supplier of the fuel tank) confirmed an investigation was conducted and found that non-conformities occurred in the rotational molding process and was corrected on January 25, 2016. Components produced from February 2016 forward have been corrected by the Supplier. As a result of the information received from the Supplier, KTM Sportmotorcycle determined a recall should be issued for affected vehicles. In October of 2018, KTM North America, Inc. was informed by KTM Sportmotorcycle GmbH about the recall being conducted worldwide.

Description of Remedy:

Description of Remedy Program: Official KTM dealers will inspect and replace the affected fuel tank cover

mounting insert with a corrected part free of charge to the customers or

offer reimbursement of previously repaired defects covered by this recall.

How Remedy Component Differs Parts are imprinted with the date of manufacturer. Remedied parts are

from Recalled Component: those manufactured from February 2016 forward.

Identify How/When Recall Condition Improved moldering process. The component manufacturer has added a was Corrected in Production: second heater coil to the manufacturing process. The second coil increases the temperature and improves the flowing behavior of the material which

results in even distribution around the threaded insert.

Recall Schedule:

Description of Recall Schedule: KTM North America is notifying all registered owners of the above

affected motorcycle by mail and all authorized KTM dealers via KTM

Dealernet, an internet based dealer communication system.

Planned Dealer Notification Date: FEB 07, 2019 - AUG 10, 2020

Planned Owner Notification Date: MAR 08, 2019 - SEP 09, 2020

Part 573 Safety Recall Report	19V-087	Page 3
* NR - Not Reported		
The information contained in this report was submitted	d rurrus and to 40 0FB 0F70	