OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 19V-206

**Manufacturer Name:** Keystone RV Company

NHTSA Recall No.: 19V-206

Manufacturer Recall No.: 19-348



#### **Manufacturer Information:**

Manufacturer Name: Keystone RV Company

Address: PO Box 2000

2642 Hackberry Drive Goshen IN

46527

Company phone: 574-535-2100

# **Population:**

Number of potentially involved: 327 Estimated percentage with defect: 100 %

#### **Vehicle Information:**

Vehicle 1: 2019-2019 Dutchmen Aspen Trail 1700BH, 1750RD, 1760BH, 1800RB, 1850RB

Vehicle Type: TRAILERS

Body Style : Power Train : NR

Descriptive Information: Single axle models using the Capital cooktop inside the unit as the main cooking

appliance.

Model Aspen Trail 190 units.

Production Dates: OCT 17, 2018 - FEB 15, 2019

VIN Range 1: Begin: 4YDT17017K8922634 End: 4YDT17613K8923688 ✓ Not sequential

Vehicle 2: 2019-2019 Dutchmen Coleman 17FQ, 17RD, 18FQ

Vehicle Type: TRAILERS

Body Style : Power Train : NR

Descriptive Information: Single axle models using the Capital cooktop inside the unit as the main cooking

appliance.

Model Coleman 137 units

Production Dates: JAN 24, 2019 - FEB 06, 2019

VIN Range 1: Begin: 4YDT17F18KH938316 End: 4YDT18F18KH938452 ✓ Not sequential

#### **Description of Defect:**

Description of the Defect: It has been decided that the vehicles in the recall population have a Capital

two-burner cooktop that the burner flame may by be affected during furnace

operation.

FMVSS 1: NR FMVSS 2: NR Description of the Safety Risk: Under certain conditions during furnace operation, the burner flame can

invert leading to an increased risk of personal injury, and/or fire.

Description of the Cause: The Capital two burner cooktop is installed in a cabinet that is not entirely

sealed from the furnace cavity.

Identification of Any Warning When the furnace is operated it may affect the burner flames causing the

that can Occur: cooktop surface to get very hot.

# **Supplier Identification:**

## **Component Manufacturer**

Name: NR

Address: NR

NR

Country: NR

## **Chronology:**

3/4/2019 – Report was made from KZ-RV that a condition may exist that affects the function of the burner when mounted inside of a unit.

3/5/2019 – A model with the Capital two burner cooktop was reviewed to determine if the condition existed in Keystone produced products.

3/6/2019 – Keystone Safety Committee reviewed the information and determined that other models need to be reviewed. Investigation called for to determine affected unit range and model scope.

3/11/2019 – Investigation concluded and scope completed.

#### **Description of Remedy:**

Description of Remedy Program: The remedy is to remove the existing cooktop and install a different brand

that is not affected in the same manner as the Capital two-burner cooktop.

How Remedy Component Differs The different brand of cooktop allows for the same installation without

from Recalled Component: affecting the burner function during use of the furnace.

Identify How/When Recall Condition Units were quarantined, inspected then repaired as indicated by

was Corrected in Production: inspection.

#### **Recall Schedule:**

Description of Recall Schedule: Keystone will notify the dealers and owners of the recreational vehicles

by letter. A final copy of the owner letter will be provided to NHTSA,

along with the dealer repair procedures.

The information contained in this report was submitted pursuant to 49 CFR §573

# **Part 573 Safety Recall Report**

19V-206

Page 3

Planned Dealer Notification Date: MAY 07, 2019 - MAY 07, 2019 Planned Owner Notification Date: MAY 07, 2019 - MAY 07, 2019

\* NR - Not Reported