#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 19V-609

Manufacturer Name: Thor Motor Coach
Submission Date: AUG 20, 2019
NHTSA Recall No.: 19V-609
Manufacturer Recall No.: RC000172



#### **Manufacturer Information:**

# **Population:**

Manufacturer Name: Thor Motor Coach

Number of potentially involved: 829

Address: PO Box 1486

Estimated percentage with defect : 100 %

701 County Road 15 Elkhart IN 46515

Company phone: 877-500-1020

### **Vehicle Information:**

Vehicle 1: 2020-2020 Chateau 27R, 28E, 28Z, 30D, 31E, 31W, 31Y

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: -It has been discovered that on certain model year 2020 Chateau, Daybreak, Four

Winds, Freedom Elite, Outlaw, Quantum Motorhomes, a loose connection exists between the Battery Isolation Manager (BIM) or the Battery Isolation Relay (BIR) and

attached battery cables.

-Recalled products do not have lock washers on isolator relay studs.

-140 Chateau units are a part of the recall population.

Production Dates: MAR 15, 2019 - JUL 16, 2019

VIN Range 1: Begin: 1FDXE4FSXKDC25579 End: 1FDWE3FS5KDC31862 ✓ Not sequential

Vehicle 2: 2020-2020 Daybreak 30DB

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: -It has been discovered that on certain model year 2020 Chateau, Daybreak, Four

Winds, Freedom Elite, Outlaw, Quantum Motorhomes, a loose connection exists between the Battery Isolation Manager (BIM) or the Battery Isolation Relay (BIR) and

attached battery cables.

-Recalled products do not have lock washers on isolator relay studs.

-20 Daybreak units are a part of the recall population.

Production Dates: MAR 15, 2019 - JUL 16, 2019

VIN Range 1: Begin: 1FDXE4FSXKDC25579 End: 1FDWE3FS5KDC31862 ✓ Not sequential

Vehicle 3: 2020-2020 Four Winds 27R, 28E, 28Z, 30D, 31E, 31W, 31Y

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: -It has been discovered that on certain model year 2020 Chateau, Daybreak, Four

Winds, Freedom Elite, Outlaw, Quantum Motorhomes, a loose connection exists between the Battery Isolation Manager (BIM) or the Battery Isolation Relay (BIR) and

attached battery cables.

-Recalled products do not have lock washers on isolator relay studs.

-169 Four Winds units are a part of the recall population.

Production Dates: MAR 15, 2019 - JUL 16, 2019

VIN Range 1: Begin: 1FDXE4FSXKDC25579 End: 1FDWE3FS5KDC31862 ✓ Not sequential

Vehicle 4: 2020-2020 Freedom Elite 28FE, 30FE, 23H, 22FE, 22HE

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style: OTHER Power Train: GAS

Descriptive Information: -It has been discovered that on certain model year 2020 Chateau, Daybreak, Four

Winds, Freedom Elite, Outlaw, Quantum Motorhomes, a loose connection exists between the Battery Isolation Manager (BIM) or the Battery Isolation Relay (BIR) and

attached battery cables.

-Recalled products do not have lock washers on isolator relay studs.

-301 Freedom Elite units are a part of the recall population.

Production Dates: MAR 15, 2019 - JUL 16, 2019

VIN Range 1: Begin: 1FDXE4FSXKDC25579 End: 1FDWE3FS5KDC31862 ✓ Not sequential

Vehicle 5: 2020-2020 Outlaw 29J, 29S

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: -It has been discovered that on certain model year 2020 Chateau, Daybreak, Four

Winds, Freedom Elite, Outlaw, Quantum Motorhomes, a loose connection exists between the Battery Isolation Manager (BIM) or the Battery Isolation Relay (BIR) and

attached battery cables.

-Recalled products do not have lock washers on isolator relay studs.

-34 Outlaw units are a part of the recall population.

Production Dates: MAR 15, 2019 - JUL 16, 2019

VIN Range 1: Begin: 1FDXE4FSXKDC25579 End: 1FDWE3FS5KDC31862 ✓ Not sequential

Vehicle 6: 2020-2020 Quantum GR22, JM31, KW29, LF31, PD31, RC25, RS26, RW28, WS31

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: -It has been discovered that on certain model year 2020 Chateau, Daybreak, Four

Winds, Freedom Elite, Outlaw, Quantum Motorhomes, a loose connection exists between the Battery Isolation Manager (BIM) or the Battery Isolation Relay (BIR) and

attached battery cables.

-Recalled products do not have lock washers on isolator relay studs.

-165 Quantum units are a part of the recall population.

Production Dates: MAR 15, 2019 - JUL 16, 2019

VIN Range 1: Begin: 1FDXE4FSXKDC25579 End: 1FDWE3FS5KDC31862 ✓ Not sequential

# **Description of Defect:**

Description of the Defect: A loose connection exists between the BIM/BIR and attached battery cables.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: The loose connection not only causes premature failure of the BIM/BIR, but it

can also create arcing, which can lead to a fire and property damage.

Description of the Cause: BIM/BIR are attached to battery cables and torqued per the specifications.

During mounting of the BIM/BIR in the motorhome and connection of the other end of the cables to the chassis battery, there is a possibility of the battery cable becoming loose on the BIM/BIR side depending on the orientation of the

BIM when mounted.

Identification of Any Warning NA

that can Occur:

#### **Supplier Identification:**

#### **Component Manufacturer**

Name: NR

Address: NR

NR

Country: NR

# **Chronology:**

7/2/2019 TMC was made aware of a fire incident.

8/8/19 Cause and origin investigation with all parties present to determine cause of fire.

8/9/19 In speaking to our fire investigator, it was determined that the connection on the Battery Isolation Manager (BIM) to the battery cables was loose creating an arc.

8/12/19 Worked with TMC Engineering a scope of units to inspect in the field that had the same BIM or a Battery Isolation Relay (BIR) (same wiring).

8/15/19 Results from the field inspections determined that we had a problem with loose connections on the battery cable.

8/16/19 TMC Safety Committee met and determined that a recall was needed

8/16/19 Finalized the scope of units affected.

# **Description of Remedy:**

Description of Remedy Program: TMC will provide instructions to dealers on how to install lock washers to

properly secure the BIM/BIR to the battery cable. If the cable was loose, it

is also recommended to replace the BIM/BIR. Reimbursement will be

provided through the normal warranty claim process.

from Recalled Component:

How Remedy Component Differs Remedy component has lock washers on the Battery Isolation Relay studs.

Identify How/When Recall Condition An ECN change was implemented on 6/19/19 to add lock washers to

was Corrected in Production: isolator relay studs.

#### **Recall Schedule:**

Description of Recall Schedule: TMC will notify the dealers and owners of the recreational vehicles by

letter. A final copy of the owner letter will be provided to NHTSA, along

with the dealer repair procedures.

Planned Dealer Notification Date: OCT 20, 2019 - OCT 20, 2019

Planned Owner Notification Date: OCT 20, 2019 - OCT 20, 2019

\* NR - Not Reported