OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 19V-858

**Manufacturer Name:** Piaggio Group Americas. Inc.

**Submission Date:** DEC 03, 2019 **NHTSA Recall No.:** 19V-858

**Manufacturer Recall No.:** NR



#### **Manufacturer Information:**

Manufacturer Name: Piaggio Group Americas. Inc.

Address: 257 Park Avenue South

4th Floor New York NY 10010

Company phone: 645-0030

#### **Population:**

Number of potentially involved: 399 Estimated percentage with defect: 2 %

#### **Vehicle Information:**

Vehicle 1: 2020-2020 Moto Guzzi V 85 TT

Vehicle Type: MOTORCYCLES

Body Style : OTHER Power Train : GAS

Descriptive Information: The recall population is the whole world wide production of this vehicle model since

the start of production in February 2019 until November 2019. the recalled components (P/N AP8120573) were changed to a different part (P/N AP8152409)

that does not deform during assembly.

Production Dates: MAY 07, 2019 - OCT 11, 2019

VIN Range 1: Begin: ZGUKWU00XLM000001 End: ZGUKWU008LM000496 ✓ Not sequential

### **Description of Defect:**

Description of the Defect: The retaining clip that keeps the footrests of the motorcycle in position may

break. Consequently the pin may slip off, forced by vehicle vibrations, and the

complete footrest can come off the vehicle.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Footrests may be lost while running.

Description of the Cause: The retaining ring keeping the footrest in position may break due to the

deformation of the retaining clip during incorrect assembly operation.

Identification of Any Warning Unstable position of the footrest. Noise may be heard coming from loosened

that can Occur: parts.

#### **Supplier Identification:**

#### **Component Manufacturer**

Name: NR Address: NR

NR

Country: NR

## **Chronology:**

In September of 2019 the Piaggio After-sales Department began to report about warranties related to retaining rings broken and lost. In several cases the pin slipped off and the footrest was lost. The Piaggio Engineering Department found that the assembly metod of the retaining ring (P/N AP8120573) may cause deformation of the component or incorrect positioning on the final product.

We will send the list of claims in a seperate document.

#### **Description of Remedy:**

Description of Remedy Program : Safety Recall Campaign: Customer brings the motorcycle to the dealer,

who is requested to replace the retaining rings on all four footrests

supplied by Piaggio for the customer free of charge.

How Remedy Component Differs The remedy component P/N AP8152409 (DIN 471) has a different shape

from Recalled Component : compared to the previous retaining ring P/N AP8120573 (DIN 6799)

Identify How/When Recall Condition the production has completed in November 2019 and there will not be was Corrected in Production: December production. Starting from January 1, 2020 the new vehicles will

be assembled with retaining rings P/N AP8152409.

#### **Recall Schedule:**

Description of Recall Schedule: NR

Planned Dealer Notification Date : NR - NR Planned Owner Notification Date : NR - NR

\* NR - Not Reported