OMB Control No.: 2127-0004

Part 573 Safety Recall Report

20V-122

Manufacturer Name: Hyundai Motor America

NHTSA Recall No.: 20V-122

Manufacturer Recall No.: 190



Manufacturer Information:

Manufacturer Name: Hyundai Motor America

Address: 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone: 800-633-5151

Population:

Number of potentially involved : 5,044 Estimated percentage with defect : $100\,\%$

Vehicle Information:

Vehicle 1: 2020-2020 Hyundai Sonata

Vehicle Type: LIGHT VEHICLES

Body Style : 4-DOOR Power Train : GAS

Descriptive Information: The subject vehicles include certain model year 2020 Hyundai Sonata vehicles

produced between October 22, 2019 and February 13, 2020 by Hyundai Motor

Manufacturing Alabama ("HMMA") for sale in the U.S. market.

Production Dates: OCT 22, 2019 - FEB 13, 2020

Description of Noncompliance:

Description of the The tire size specifications set forth in the owner's manual and tire pressure

Noncompliance: label may indicate incorrect values for the sidewall aspect ratio, resulting in a

failure to comply with Federal Motor Vehicle Safety Standard ("FMVSS")

number 110, "Tire Selection and Rims."

FMVSS 1: 110 - Tire selection and rims

FMVSS 2: NR

Description of the Safety Risk: Incorrect tire size specifications could lead to the installation of mismatched

tires, increasing the risk of a crash.

Description of the Cause: The label was printed using tire size specifications from an incorrect drawing.

Identification of Any Warning NR

that can Occur:

Supplier Identification:

Component Manufacturer

Name: Hyundai Motor Company

Address: NR

NR

Country: NR

Chronology:

During a routine line inspection occurring on February 17, 2020, HMMA discovered that model year 2020 Sonata vehicles were being shipped with factory tires that did not match the tire size specifications indicated on the tire pressure label. HMMA initiated a "stop ship" of production vehicles and informed Hyundai Motor Company ("HMC") of their findings. HMC's subsequent investigation revealed that the aspect ratio specification listed on the drawing was incorrect. HMMA communicated HMC's findings to Hyundai Motor America ("HMA") on February 18, 2020. Based on the information including the number of affected vehicles received, on February 25, 2020, HMA convened its Technical Committee and decided to conduct a noncompliance recall in the U.S. market to address the labels and owner manuals in all affected vehicles.

To date, Hyundai is unaware of any fires, accidents, or injuries related to this condition.

Description of Remedy:

Description of Remedy Program: Hyundai Motor America plans to notify owners of affected vehicles to

return their vehicles to their Hyundai dealers to install new label stickers over the affected areas of the tire pressure label and owner's manual. This

procedure will be performed at no charge.

Hyundai will provide reimbursement to owners for repairs according to

the plan submitted on May 16, 2018.

How Remedy Component Differs The new label stickers indicate the correct tire aspect ratio.

from Recalled Component:

Identify How/When Recall Condition The labeling equipment programming was revised on February 20, 2020.

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: Dealers and owners will be notified in April 2020.

Planned Dealer Notification Date : APR 24, 2020 - APR 24, 2020 Planned Owner Notification Date : APR 24, 2020 - APR 24, 2020

Part 573 Safety Recall Report	20V-122	Page 3
* NR - Not Reported		
The information contained in this report was submitted		