

# Part 573 Safety Recall Report

# 20V-407

**Manufacturer Name :** Blue Bird Body Company**Submission Date :** JUL 15, 2020**NHTSA Recall No. :** 20V-407**Manufacturer Recall No. :** R20AX-NSB**Manufacturer Information :****Population :**

Manufacturer Name : Blue Bird Body Company

Number of potentially involved : 149

Address : P.O. Box 937  
402 Blue Bird Boulevard Fort Valley  
GA 31030

Estimated percentage with defect : 50 %

Company phone : 478-822-2242

**Vehicle Information :**

Vehicle 1 : 2019-2021 Blue Bird Vision

Vehicle Type : BUSES, MEDIUM &amp; HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

**Descriptive Information :** It has been determined that certain Blue Bird buses may fail to conform to the Federal Motor Vehicle Safety Standard No. 210 " Seat Belt Assembly Anchorages" requirements for seats with integrated 3-point seat belts due to the omission of one of the reinforcement washers under the floor in certain areas. Blue Bird will conduct a recall to correct this noncompliance. The seat installation on subject buses must be inspected and corrected according to the Blue Bird recall instructions, if found to be installed incorrectly. Blue Bird evaluated the risk to motor vehicle safety related to this noncompliance and determined that, in the event of an accident, there is a potential for injury to the occupant if these 3-point seat belt seats are installed incorrectly.

Production Dates : JUL 02, 2018 - JUN 08, 2020

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2019-2021 Blue Bird All American  
Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES  
Body Style : OTHER  
Power Train : DIESEL

**Descriptive Information :** It has been determined that certain Blue Bird buses may fail to conform to the Federal Motor Vehicle Safety Standard No. 210 " Seat Belt Assembly Anchorages" requirements for seats with integrated 3-point seat belts due to the omission of one of the reinforcement washers under the floor in certain areas. Blue Bird will conduct a recall to correct this noncompliance. The seat installation on subject buses must be inspected and corrected according to the Blue Bird recall instructions, if found to be installed incorrectly. Blue Bird evaluated the risk to motor vehicle safety related to this noncompliance and determined that, in the event of an accident, there is a potential for injury to the occupant if these 3-point seat belt seats are installed incorrectly.

Production Dates : JUN 29, 2018 - JAN 28, 2020

VIN Range 1 : Begin :

NR

End : NR

Not sequential

## Description of Noncompliance :

**Description of the Noncompliance :** It has been determined that certain Blue Bird buses may fail to conform to the Federal Motor Vehicle Safety Standard No. 210 " Seat Belt Assembly Anchorages" requirements for seats with integrated 3-point seat belts due to the omission of one of the reinforcement washers under the floor in certain areas. Blue Bird will conduct a recall to correct this noncompliance. The seat installation on subject buses must be inspected and corrected according to the Blue Bird recall instructions, if found to be installed incorrectly. Blue Bird evaluated the risk to motor vehicle safety related to this noncompliance and determined that, in the event of an accident, there is a potential for injury to the occupant if these 3-point seat belt seats are installed incorrectly.

FMVSS 1 : NR

FMVSS 2 : 210 - Seat belt assembly anchorages

**Description of the Safety Risk :** Blue Bird evaluated the risk to motor vehicle safety related to this noncompliance and determined that, in the event of an accident, there is a potential for injury to the occupant if these 3-point seat belt seats are installed incorrectly.

**Description of the Cause :** It has been determined that certain Blue Bird buses may fail to conform to the Federal Motor Vehicle Safety Standard No. 210 " Seat Belt Assembly Anchorages" requirements for seats with integrated 3-point seat belts due to the omission of one of the reinforcement washers under the floor in certain areas. Blue Bird will conduct a recall to correct this noncompliance. The seat installation on subject buses must be inspected and corrected according to the Blue Bird recall instructions, if found to be installed incorrectly. Blue Bird evaluated the risk to motor vehicle safety related to this noncompliance and determined that, in the event of an accident, there is a potential for injury to the

occupant if these 3-point seat belt seats are installed incorrectly.

Identification of Any Warning that can Occur : There is no audible or visual warning, which would precede an event.

## Involved Components :

Component Name 1 : WASHER,SEAT BELT,UNDERFLOOR LEG ATTACHMENT

Component Description : Underfloor Washer

Component Part Number : 10054386

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

## Chronology :

On July 3, 2020, a Blue Bird audit discovered that certain school bus seats with integrated 3-point seat belts were not installed according per the engineering instructions. Blue Bird initiated a stop delivery that same day to inspect a total of 59 buses still on property with these seats. During the inspection, Blue Bird determined that 17 of the 59 were found to have underfloor reinforcement washers omitted which were required. These buses were corrected prior to delivery. Blue Bird has determined that a total of 3,691 buses have been sold in North America (United States and Canada populations combined) with these same seats. Blue Bird decided to issue a recall on July 10, 2020 to inspect all buses delivered prior to July 3, 2020 to ensure the proper seat installation on the units.

## Description of Remedy :

Description of Remedy Program : Visual inspection will be required to ensure that the proper seat hardware is installed. If any components are missing, the necessary seat hardware will be installed according to the Blue Bird recall instructions.

How Remedy Component Differs from Recalled Component :

A remedied seat installation will have an underfloor washer installed at each of the rear seat bolt locations.

Identify How/When Recall Condition was Corrected in Production :

On July 3, 2020, a Blue Bird audit discovered that certain school bus seats with integrated 3-point seat belts were not installed according per the engineering instructions. Blue Bird initiated a stop delivery that same day to inspect a total of 59 buses still on property with these seats. During the inspection, Blue Bird determined that 17 of the 59 were found to have underfloor reinforcement washers omitted which were required. These buses were corrected prior to delivery. Blue Bird decided to issue a recall on July 10, 2020 to inspect all buses delivered prior to July 3, 2020 to ensure the proper seat installation on the units.

## Recall Schedule :

Description of Recall Schedule :

Campaign Name:

R20AX – FMVSS 210 Noncompliance – Installation of Seats with 3-Point Belts

Parts Availability: September 30, 2020

Planned Dealer Notification Date :

SEP 11, 2020 - SEP 11, 2020

Planned Owner Notification Date :

SEP 11, 2020 - SEP 11, 2020

\* NR - Not Reported