OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 21V-302

Manufacturer Name: Hyundai Motor America

NHTSA Recall No.: 21V-302

Manufacturer Recall No.: 204



#### **Manufacturer Information:**

Manufacturer Name: Hyundai Motor America

Address: 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone: 800-633-5151

## **Population:**

Number of potentially involved: 1,464 Estimated percentage with defect: 1 %

#### **Vehicle Information:**

Vehicle 1: 2021-2021 Hyundai Elantra

Vehicle Type: LIGHT VEHICLES

Body Style : 4-DOOR Power Train : GAS

Descriptive Information: Certain model year 2021 Hyundai Elantra vehicles produced from October 19, 2020

through November 5, 2020 by Hyundai Motor Manufacturing Alabama ("HMMA") for

sale in the U.S. market.

Production Dates: OCT 19, 2020 - NOV 05, 2020

#### **Description of Defect:**

Description of the Defect: The driver/passenger seat back frame assemblies in the subject vehicles may

have been assembled with seat back recliners that were improperly welded

during manufacturing by the seat frame supplier.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: An improperly welded seat back recliner could lead to separation of the seat

back from the frame in the event of a crash, increasing the risk of injury to

occupants.

Description of the Cause: The laser weld output was reduced due to a damaged laser lens cover during

manufacturing.

Identification of Any Warning None

that can Occur:

### **Involved Components:**

Component Name 1: FRAME ASSY-FRONT SEAT BACK

Component Description: Seat back frame assembly for 2021 Elantra

Component Part Number: 88310-AB010 (LH) / 88410-AB010 (RH)

### **Supplier Identification:**

### **Component Manufacturer**

Name: Lear/DAS

Address: NR

NR

Country: NR

#### **Chronology:**

Please see Attachment A for the requested chronology.

## **Description of Remedy:**

Description of Remedy Program: Hyundai plans to notify owners to bring their vehicles to the nearest

Hyundai dealership for inspection and, if necessary, replacement of the

seat back frame assembly.

The remedy procedure will be performed at no charge. Hyundai will

provide reimbursement to owners for repairs according to the plan

submitted on May 16, 2018.

How Remedy Component Differs 
The remedy seat back frame assembly is welded to the correct

from Recalled Component: specification.

Identify How/When Recall Condition The seat frame supplier improved laser welding speed and implemented

was Corrected in Production: 100% inspection of end-of-line production parts in December 2020.

#### **Recall Schedule:**

Description of Recall Schedule: Dealers and owners will be notified in late June 2021.

Planned Dealer Notification Date : JUN 25, 2021 - JUN 25, 2021 Planned Owner Notification Date : JUN 25, 2021 - JUN 25, 2021

Part 573 Safety Recall Report	21V-302	Page 3
* NR - Not Reported		