

Part 573 Safety Recall Report

21V-317

Manufacturer Name : Jayco, Inc.**Submission Date :** MAY 05, 2021**NHTSA Recall No. :** 21V-317**Manufacturer Recall No. :** 9901566**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 559

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2021 Travel Trailer Jay Feather Micro

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Scope created from operations report of travel trailers built with spare tire carrier with defect.

2021 Jay Feather Micro

M1JG0051-0379

M1JK0050-0321

M1JM0051-0102

Production Dates : OCT 12, 2020 - APR 23, 2021

VIN Range 1 : Begin :

NR

End : NR

☐ Not sequential**Description of Defect :**

Description of the Defect : Spare tire carrier may break at bend radius or gusset and fall off of the travel trailer during transit.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Spare tire carrier may break and fall off of the trailer causing a road hazard increasing the risk of an accident.

Description of the Cause : Supplier design issue

Identification of Any Warning NR
that can Occur :

Involved Components :

Component Name 1 : Tire Carrier

Component Description : CARRIER,TIRE CLOSEOFF MOUNTED 40"

Component Part Number : 2014093

Supplier Identification :**Component Manufacturer**

Name : Norco Industries

Address : 2800 Northland Dr
Elkhart Indiana 46514

Country : United States

Chronology :

4/20/21-Incident reported tire carrier broke during transit to dealer. 4/26/21-Incident details discussed at WIRC and elevated to CPAC for further research. 4/27/21 all units on premises placed on hold. Inspections of units detected cracks starting at the location of the gusset within spare tire carrier. 4/27/21 Supplier Norco onsite to review units. Jayco engineering developed design and prototype parts fabricated for remedy. 4/29/21 Jayco completes FEA on remedy part. FEA test confirms that repair brackets will support anticipated load. 4/29/21-4/30/21 all units onsite and in transport yard were repaired with recall remedy. 4/30/21 CPAC reviewed all details of incident and elevated to SSC. 5/3 SSC reviewed all details and approved recall required.

Description of Remedy :

Description of Remedy Program : Bolt on 2 - Z brackets to the original spare tire carrier for additional reinforcement.

How Remedy Component Differs from Recalled Component : Addition of the 2 - Z brackets.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Jayco to release recall upon receipt of remedy parts.

Planned Dealer Notification Date : JUN 04, 2021 - JUN 04, 2021

Planned Owner Notification Date : JUN 04, 2021 - JUN 04, 2021

* NR - Not Reported