

Part 573 Safety Recall Report

21V-563

Manufacturer Name : Gillig, LLC
Submission Date : JUL 23, 2021
NHTSA Recall No. : 21V-563
Manufacturer Recall No. : NR

**Manufacturer Information :**

Manufacturer Name : Gillig, LLC
Address : 451 Discovery Drive
 LIVERMORE CA 94551
Company phone : 1-800-735-1500

Population :

Number of potentially involved : 148
Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2020-2021 GILLIG LOW FLOOR
Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES
Body Style : ALL
Power Train : DIESEL

Descriptive Information :

Cummins has recently launched a campaign (NHTSA id. 21E-063) to recall a population of Model Year 2021 L9 Diesel engines with defective fuel hoses that can result in fuel leakage and, therefore, increase the risk of fire. As a consequence of this decision, GILLIG is recalling the bus population equipped with the engines that may be affected by the issue.

Production Dates : NOV 25, 2020 - JUN 29, 2021

VIN Range 1 : Begin : 15GGE2715M3093895 **End :** 15GGE2717M3094045 Not sequential

Description of Defect :

Description of the Defect : A fuel leak may occur in the fuel hoses between the fuel pump and remote filter head.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A fuel leak in the presence of an ignition source may increase the risk of a fire.

Description of the Cause : The cause of the issue is inadequate design and quality of the fuel hose assembly.

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : Fuel filter hoses

Component Description : Remote fuel filter connection hoses

Component Part Number : Cummins part# 5563641-2-3

Supplier Identification :

Component Manufacturer

Name : Cummins

Address : Box 41303

Columbus Indiana 47202

Country : United States

Chronology :

07/16/2021 GILLIG Compliance Dept. received notification about a new NHTSA recall campaign #21E-063 filed by Cummins. The engine OEM provided a list of engine serial numbers potentially affected by the subject issue.

07/20/2021 GILLIG completed population analysis and identified 148 vehicles potentially affected by this recall.

07/23/2021 GILLIG notified NHTSA by filing a formal vehicle recall.

Description of Remedy :

Description of Remedy Program : Cummins will administer this recall. The remedy will be to replace the subject fuel hoses, to and from the remote fuel filter, with fuel hoses of a new design.

How Remedy Component Differs from Recalled Component : The defective fuel hoses (Cummins part number# 5563641-2-3) will be replaced by new fuel hoses with a unique part number and visibly different.

Identify How/When Recall Condition was Corrected in Production : The Cummins production of engines with the new design fuel hoses began on June 15. These engines are being phased in to the GILLIG vehicle production.

Recall Schedule :

Description of Recall Schedule : Recall notices will be sent in coordination with Cummins recall notices.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : SEP 20, 2021 - SEP 20, 2021

* NR - Not Reported