Part 573 Safety Recall Report

Manufacturer Name :Nissan North America, Inc.Submission Date :MAR 03, 2022NHTSA Recall No. :22V-111Manufacturer Recall No. :PC867 PC868

Manufacturer Information :

Manufacturer Name : Nissan North America, Inc. Address : P. O. BOX 685001 Franklin TN 37068-5009 Company phone : 800-647-7261

Vehicle Information :

Vehicle 1:	2022-2022 Nissan Pathfinder		
Vehicle Type :	LIGHT VEHICLES		
Body Style :	SUV		
Power Train :	GAS		
Descriptive Information :	Based on the Tier 1 (Adient) su reinstallation process of a limit 2022 Pathfinder and QX60 veh outlined above. No other Nissa	ted number of second-row icles, manufactured during	seat tracks for certain MY g the specified time periods
Production Dates :	NOV 03, 2021 - NOV 19, 2021		
VIN Range 1:	Begin : NR	End: NR	Not sequential
Vehicle Type : Body Style : Power Train :	GAS		
Descriptive Information :	Based on the Tier 1 (Adient) supplier records, the issue occurred during the reinstallation process of a limited number of second-row seat tracks for certain MY 2022 Pathfinder and QX60 vehicles, manufactured during the specified time periods outlined above. No other Nissan or INFINITI vehicles are affected.		
Production Dates :	NOV 30, 2021 - NOV 30, 2021		
VIN Range 1:	Begin: NR	End: NR	□ Not sequential



Number of potentially involved :

Estimated percentage with defect : 24 %

Population :

21

22V-111

Part 573 Safety Recall Report

22V-111

Page 2

Description of Noncompliance :

Description of the	Assembly issues during the reinstallation process for the subject second-row
Noncompliance :	seat tracks at the Tier 1 supplier (Adient) may have resulted in a missing
	mounting bolt. If a mounting bolt is missing, the seat track may move in the
	event of a crash, increasing the risk of injury. This condition is non-compliant
	with S4.2.2 of FMVSS 210; Seat Belt Assembly Anchorages.
FMVSS 1 :	210 - Seat belt assembly anchorages
FMVSS 2 :	NR
Description of the Safety Risk :	If a mounting bolt is missing, the seat track may move in the event of a crash, increasing the risk of injury.
Description of the Cause :	NR
Identification of Any Warning	The mounting bolt is visibly missing.
that can Occur :	

Involved Components :

(

Component Name 1:	BOLT
Component Description :	Mounting Bolt
Component Part Number :	88921 6TA2A

Supplier Identification :

Component Manufacturer

Name : Adient US-LLC Address : 1501 Molloy Lane Murfreesboro Tennessee 37219 Country : United States

Chronology :

December 16, 2021 – A plant technician noticed a missing bolt in the rail of a vehicle's second row seat when he tilted the seat forward to make a carpet adjustment to the third-row floor. Nissan initiated containment measures and immediately began an investigation.

December 2021 through January 2022 – The Tier 2 supplier and Nissan conducted their respective investigations. During this time, both Nissan and the supplier conducted yard audits totaling 27, 731 seat

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

tracks and pursued investigation of the issue with the Tier 1 supplier.

During the Tier 1 supplier investigation, it was determined that an operator may have inadvertently removed the bolt during a limited reinstallation procedure, which narrowed the scope of the potentially affected population of seat tracks. Nissan implemented a countermeasure in production to prevent the issue from reoccurring. Concurrently, Nissan initiated a safety assessment to investigate the impact of the missing bolt on the regulation.

February 2022 – Nissan's safety assessment determined that if the bolt is missing, the seat track may move in the event of a crash and potentially increase the risk of injury.

February 16, 2022 - Nissan decided to conduct a Voluntary Safety Recall to inspect, and remedy if necessary, all potentially affected vehicles.

Nissan is not aware of any warranty claims attributed to this condition.

Description of Remedy :

Description	n of Remedy Program :	Dealers will inspect the second-row seat track for the missing mounting bolt and install a new mounting bolt if necessary.
		We will not include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy as the subject vehicles are under warranty.
	edy Component Differs Recalled Component :	NR
•	When Recall Condition rrected in Production :	NR

Recall Schedule :

Description of Recall Schedule :	Nissan will notify all owners of potentially affected vehicles by April 4, 2022. Dealers were notified February 25, 2022.
Planned Dealer Notification Date :	FEB 25, 2022 - NR
Planned Owner Notification Date :	APR 04, 2022 - NR

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573