OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-540

Manufacturer Name: Nova Bus (US) Inc.

Submission Date: AUG 02, 2023

NHTSA Recall No.: 23V-540

Manufacturer Recall No.: CR5461



Manufacturer Information:

Manufacturer Name: Nova Bus (US) Inc.

Address: 260 Banker Road

PLATTSBURGH NY 12901

Company phone: 450-472-6410

Population:

Number of potentially involved : 13 Estimated percentage with defect : 15 %

Vehicle Information:

Vehicle 1: 2022-2023 Nova Bus LFS

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : NR

Descriptive Information: All battery electric vehicles equipped with Akasol Gen3 high voltage battery packs

manufactured by Akasol US.and that were assembled and/or reworked with improper torque control for the bus-bars assemblies connecting battery modules in

the battery pack.

Production Dates: MAR 15, 2022 - FEB 24, 2023

Description of Defect:

Description of the Defect: Certain bus-bar terminal blocks may be over torqued and could fail. Under

certain conditions, the failed terminal block portion can become a loose

metallic debris in the battery pack.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Under certain conditions, loose metallic debris in the battery pack may cause

a short circuit and may lead to a thermal event of the battery pack which may increase the risk of a vehicle fire. Occurrence may happen with vehicle is in

operation, charging or parked.

Nova Bus has not received any consumer complaint, field report, warranty claim, property damage claim, and neither notice or claim of injury or death associated with this defect. Therefore, we consider this as a proactive

measure to protect the public from the potential safety risk associated with

this defect.

Part 573 Safety Recall Report

23V-540

Page 2

Description of the Cause: Battery pack supplier manufacturing defect during certain assembly and

rework operations due to inadequate process control and detection related to

those defects.

Identification of Any Warning When the vehicle is in operation or charging if a thermal event is developing in

that can Occur: the battery pack, the thermal runaway detection tell-tale warning to the driver

will illuminate. Safely stop and park the vehicle outside away from any

property.

Involved Components:

Component Name 1: Battery

Component Description: High voltage battery pack

Component Part Number: 23962990

Component Name 2: Battery

Component Description: High voltage battery pack

Component Part Number: 24264513

Supplier Identification:

Component Manufacturer

Name: Akasol Inc.

Address: 1400 E. 10 Mile Road

Suite 15 Hazel Park Michigan 48030

Country: United States

Chronology:

2023-07-05: Volvo Trucks NA Manufacturing and Purchasing report that they have discovered a battery pack on their property that

had a thermal event (contained in the battery pack and no propagation in the battery pack).

2023-07-11: Nova Bus Product Safety Evaluation Committee is informed, investigation opened together with Trucks NA and Akasol supplier.

2023-07-13: Nova Bus issues a preventive delivery stop for its plants.

2023-07-19: Volvo/Mack Trucks NA Product Safety Working Group reviews the product safety investigation results and recommends that this be brought to Trucks NA Product Safety Committee as a potential product

safety defect.

2023-07-19: Trucks NA Product Safety Committee meets and decides that a product safety defect exists. 2023-07-20: Nova Bus Product Safety Evaluation Committee evaluates this Potential Safety-Related Issue and raise it to the Nova Bus Product Safety Committee.

2023-07-20: Nova Bus Product Safety Committee evaluates this Potential Safety-Related Issue and decides more information is required to make a determination.

2023-07-28: Nova Bus Product Safety Committee evaluates this Potential Safety-Related Issue and determines a Safety-Related Defect exists.

2023-08-02: Nova Bus submits a vehicle recall report to NHTSA.

Nova Bus has not received any consumer complaint, field report, warranty claim, property damage claim, and neither notice or claim of injury or death associated with this defect. Therefore, we consider this as a proactive measure to protect the public from the potential safety risk associated with this defect. The battery pack incident which initiated the investigation involved one battery pack which was on a trailer in shipment to Volvo Trucks NA assembly operations. The battery pack was the only one found damaged with no spread of damage to the other battery packs in the shipment, or to the trailer.

Description of Remedy:

Description of Remedy Program: Nova Bus will release a service document to replace the suspected battery

packs. All costs associated with this corrective measure will be covered by Nova Bus. All affected vehicles are still under warranty. Pre-notification remedies will be addressed using the Nova Bus general reimbursement

plan on file with NHTSA.

Synchronization with the existing 23V291 CR5406 service document to be

evaluated.

How Remedy Component Differs The battery packs manufactured after 2023-04-10 and that have not been from Recalled Component: reworked at the supplier are certified good since the bus-bar torquing manufacturing operation was in control with proper tooling on the production line. All battery packs manufactured or reworked at the

supplier after 2023-07-11 are certified good.

Identify How/When Recall Condition There is a delivery stop in place since 2023-07-13. The vehicles released was Corrected in Production: will have a battery packs replacement with certified good battery packs.

Recall Schedule:

Description of Recall Schedule: Note Nova Bus does not have a dealer network and the dates entered for

the planned dealer notification begin/end date are only to avoid NHTSA

Recall Portal error while submitting the recall report.

Planned Dealer Notification Date: AUG 31, 2023 - AUG 31, 2023

Planned Owner Notification Date: AUG 31, 2023 - AUG 31, 2023

Part 573 Safety Recall Report	23V-540	Page 4
* NR - Not Reported		
The information contained in this report was submitted		