

# Part 573 Safety Recall Report

# 24V-225

**Manufacturer Name :** Daimler Vans USA, LLC**Submission Date :** MAR 24, 2024**NHTSA Recall No. :** 24V-225**Manufacturer Recall No. :** VS3HVERSL**Manufacturer Information :**

Manufacturer Name : Daimler Vans USA, LLC

Address : One Mercedes-Benz Drive  
Sandy Springs GA 30328

Company phone : 8777628267

**Population :**

Number of potentially involved : 99

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2023-2023 Mercedes-Benz Sprinter

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined through production records.

Production Dates : FEB 01, 2023 - JUN 27, 2023

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Mercedes-Benz AG ("MBAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Sprinter (907 platform) vans, the 12V ground connection quick-release fastener might not be fastened properly.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : In this case, the quick-release fastener might loosen over time and the electrical resistance on this connection might increase. Thus, the temperature in this area might increase, and a risk of fire cannot be ruled out completely. In addition, the vehicle may lose propulsion without warning.

Description of the Cause : Due to a deviation in the production process, the 12V ground connection quick-release fastener might not have been fastened properly.

Identification of Any Warning that can Occur : The driver will not receive a warning due to the nature of the failure mechanism.

**Involved Components :**

Component Name 1 : Battery Sensor

Component Description : Battery Sensor

Component Part Number : A9079050308

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

## Chronology :

Please see attached document

## Description of Remedy :

Description of Remedy Program : As a precautionary measure, authorized Mercedes-Benz Sprinter dealers will check the mounting of the quick-release fastener of the 12V ground connection on the affected vehicles and rework it, if necessary.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : A change in the production procedure ensures that this issue can no longer occur from Jun 28, 2023 onwards.

## Recall Schedule :

Description of Recall Schedule : Dealers will be notified of the pending voluntary recall campaign on Mar 29, 2024. A copy of all communications will be provided when available. Owners will be notified of the voluntary recall campaign before May 3, 2024.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported