#### The information contained in this report was submitted pursuant to 49 CFR §573

# OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

Manufacturer Name : Hyundai Motor Americ	
Submission Date :	JUL 18, 2024
<b>NHTSA Recall No. :</b>	24V-529
Manufacturer Recall No. :	263

# Manufacturer Information :

Manufacturer Name :	Hyundai Motor America
Address :	10550 Talbert Avenue
	Fountain Valley CA 92708
Company phone :	800-633-5151

# Vehicle Information :

	2024-2024 Hyundai Santa Fe LIGHT VEHICLES SUV
Power Train :	GAS
Descriptive Information :	Based on manufacturing and sales records, the subject vehicles include certain model year 2024 Hyundai Santa Fe vehicles produced on the specified dates by Hyundai Motor Manufacturing Alabama ("HMMA") for sale in the U.S. market. Other than those listed in this report, no other Hyundai/Genesis vehicles use the same component being recalled.
Production Dates :	APR 23, 2024 - JUL 02, 2024
VIN Range 1:	Begin : NR End : NR Not sequential

# **Description of Defect :**

Description of the Defect :	The Dual Clutch Transmission ("DCT") in the subject vehicles could become damaged during normal operation due to Transmission Control Unit ("TCU") software logic that could inadvertently engage the clutches and damage the transmission case and/or parking pawl. A damaged transmission case and/or parking pawl may cause noise within the transmission and/or allow for vehicle rollaway while in PARK.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	Vehicle rollaway increases the risk of a crash and injury to occupants or bystanders.
Description of the Cause :	TCU software logic error.
Identification of Any Warning that can Occur :	

**®∦**™ NHTSA



## **Population :**

Number of potentially involved : 12,349 Estimated percentage with defect : 100 %

<b>Part 573</b>	<b>Safety Recal</b>	ll Report
-----------------	---------------------	-----------

d. Unintended Parking gear selection during operation

#### **Involved Components :**

Component Name 1:	TRANSMISSION CONTROL UNIT
Component Description :	TCU specified for Hyundai Santa Fe
Component Part Number :	954A1-2N820

Component Name 2:	TRANSMISSION CONTROL UNIT
Component Description :	TCU specified for Hyundai Santa Fe
Component Part Number :	954A1-2N830

# Supplier Identification :

#### **Component Manufacturer**

Name :	Transys Korea
Address :	105 Sindang 1-ro
	Seongyeon-myeon, Seosan-si Chungcheongnam-do Foreign States 31930
Country :	Korea, Republic of

## **Chronology**:

Please see attached for the requested chronology.

The information contained in this report was submitted pursuant to 49 CFR §573

#### **Description of Remedy :**

Description of Remedy Progra	m : Hyundai recommends all affected owners to use their Electronic Parking Brake ("EPB") when parking their vehicles to mitigate the risk of vehicle rollaway while the remedy is being prepared. All owners of the subject vehicles will be notified by first class mail with instructions to bring their vehicles to a dealer for a TCU software update. In the event of a damaged transmission, the DCT will also be replaced. This remedy will be offered at no cost to owners for all affected customers Additionally, Hyundai will provide owners of affected vehicles reimbursement for out-of-pocket expenses incurred to obtain a remedy for the recall condition in accordance with the reimbursement plan submitted to NHTSA on February 22, 2024.
How Remedy Component Dif from Recalled Compone	ers The remedy includes revised TCU software logic. nt :
Identify How/When Recall Condit was Corrected in Producti	ion The revised software update was implemented at the plant on June 14, on : 2024.

#### **Recall Schedule :**

Description of Recall Schedule :	Dealers will be notified electronically on the specified dates.
	Owners will be notified by certified mail on the specified dates.
Planned Dealer Notification Date :	SEP 09, 2024 - SEP 09, 2024
Planned Owner Notification Date :	SEP 09, 2024 - SEP 09, 2024

\* NR - Not Reported