Part 573 Safety Recall Report

Manufacturer Name : Escape Trailer

Submission Date : AUG 20, 2024 NHTSA Recall No. : 24V-624

Manufacturer Recall No.: NR

Manufacturer Information :				
Manufacturer Name :	Escape Traile			

anufacturer Name : Escape Trailer Address : 43851 Industrial Way Chilliwack, BC 00 V2R4L2 Company phone : 6047031650

Vehicle Information :

Vehicle 1:	2024-2024 Escape All Models			
Vehicle Type :	TRAILERS			
Body Style :	OTHER			
Power Train :	NR			
Descriptive Information :	 Escape has identified customers who selected this oven within the affected range. The recalled product is supplied by Suburban. Other ovens we use are manufactured by a different supplier. Approximately 248 units affected 			
Production Dates :	OCT 01, 2022 - JUN 14, 2024			
VIN Range 1:	Begin :NREnd :NRNot sequential			

Population :

Description of Defect :

Description of the Defect :	 Suburban Manufacturing has decided that a defect which relates to motor vehicle safety exists in Slide-In Range Models that contain Red LED Backlit Knobs that were installed in recreational vehicles (NHTSA Safety Recall: 24E-028) The LED backlight printed circuit boards (PCB) are not fully coated. The lack of conformal coating in the connection passages between the layers of the PCB can allow liquid from the cooktop surface to accumulate, which could result in a short circuit, resulting in the PCB's failure. If the PCB fails, it can overheat, and the polyethylene cover of the lights can melt and possibly ignite, causing a fire.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	Possible fire risk
Description of the Cause :	The LED backlight printed circuit boards



Number of potentially involved : 248

Estimated percentage with defect : 100 %

24V-624

Part 573 Safety Recall Report

Page 2

(PCB) are not fully coated. The lack of conformal coating in the connection passages between the layers of the PCB can allow liquid from the cooktop surface to accumulate which could result in a short circuit resulting in the failure of the PCB. NR

Identification of Any Warning NR that can Occur :

Involved Components :

Component Name 1: Flush Mount Oven Range Elite

Component Description : Oven with range

Component Part Number: 3635A

Supplier Identification :

Component Manufacturer

Name :Suburban ManufacturingAddress :676 Broadway St.Dayton Tennessee 37321Country :United States

Chronology:

We received a recall letter (email) from GLP Canada on June 3/2024 alerting us to the issue.

The information contained in this report was submitted pursuant to 49 CFR §573

Description of Remedy :

the RV owner. Every OEM using these range models is required to their RV customers. RV owners should then book an appointment service center to get the fix completed. The fix is relatively simple quick.	at a
For Canadian-located RVs, GLP Canada will be the main point of co getting the fix kits and managing the warranty claim. Canadian ser centers or OEMs can procure kits at GLP Canada by contacting the warranty department and submitting a claim.	
For US-located RVs, the local Suburban service center in the US wi manage it directly with the Suburban Manufacturing warranty dej in the US	
How Remedy Component Differs The remedy component bypasses the faulty component in the ove from Recalled Component :	n.
Identify How/When Recall Condition was Corrected in Production :We temporarily stopped installing ovens in trailers and sent affect back to GLP Canada fo have the fix kits installed. Once ovens arrive at Escape, we installed as normal. We identified units on site that a already installed and did the recall kits ourselves.	ed back
Recall Schedule :	
Description of Recall Schedule : On June 27, 2024 Escape contacted affected customers via email to them to GLP (Canadian customers) or Suburban (US customers) We be sending physical letters in the next 3 weeks. Planned Dealer Notification Date : NR - NR	

* NR - Not Reported

Planned Owner Notification Date : AUG 26, 2024 - SEP 06, 2024