

# Part 573 Safety Recall Report

## 24V-765

**Manufacturer Name :** Lamborghini (Automobili Lamborghini)**Submission Date :** OCT 15, 2024**NHTSA Recall No. :** 24V-765**Manufacturer Recall No. :** L74X-R.02.24**Manufacturer Information :****Population :**

Manufacturer Name : Lamborghini (Automobili Lamborghini)  
 Address : Via Modena 12  
 Sant'Agata Bolognese (BO) 40019 -  
 Italy 00 99999  
 Company phone : 999

Number of potentially involved : 455  
 Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2024-2024 Automobili Lamborghini Revuelto  
 Vehicle Type : LIGHT VEHICLES  
 Body Style : 2-DOOR  
 Power Train : HYBRID ELECTRIC

Descriptive Information : The recall population was determined based on manufacturing records. Vehicles not affected by the recall are equipped with a wiper system with improved connecting rod.

**Production Dates :** APR 27, 2023 - SEP 27, 2024**VIN Range 1 :** Begin : ZHWUC1ZM8RLA00063 **End :** ZHWUC1ZM4RLA01694 ☒ Not sequential**Description of Defect :**

Description of the Defect : The connecting rod between the passenger wiper arm and the wiper motor may bend causing its separation from the wiper motor. If the connecting rod separates, the wiper becomes inoperative.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Inoperative windshield wipers can reduce visibility in certain conditions, increasing the risk of a crash.

Description of the Cause : Due to raw material properties variability combined with dimensioning limits of the wiper lever connecting rod, it could start to deform and eventually fail.

Identification of Any Warning that can Occur : None

**Involved Components :**

Component Name 1 : Passenger windshield wiper system

Component Description : Passenger windshield wiper system

Component Part Number : 47A955024

Supplier Identification :

Component Manufacturer

Name : OSLV ITALIA SRL

Address : CONTRADA SANTA LUCIA SNC

ROSETO DEGLI ABRUZZI Foreign States 64026

Country : Italy

Chronology :

In September 2024, during internal controls in the factory, Lamborghini identified a potential issue regarding the passenger windshield wiper system. The separation of the wiper arm connecting rod from the wiper motor was observed in some cars during quality controls. Lamborghini immediately began an investigation of the issue.

Analysis demonstrated reduced performance of the wiper arm connecting rod.

During the analysis period, Lamborghini identified 6 warranty claims related to this issue worldwide. While no cases have been registered in USA.

On October 8, 2024, the Lamborghini Product Safety Committee determined that a defect related to motor vehicle safety exists and decided to conduct a voluntary safety recall.

Lamborghini is not aware of any crashes or injuries related to this issue.

Description of Remedy :

Description of Remedy Program : Automobili Lamborghini S.p.A. will notify all owners of affected vehicles and will instruct them to arrange for an appointment with an authorized Lamborghini dealer. Dealers will replace the passenger wiper system connecting rod with an improved part, free of charge. All vehicles are within warranty period therefore no reimbursement plan is necessary at this moment.

How Remedy Component Differs from Recalled Component : Remedied vehicles will have an improved wiper arm connecting rod.

Identify How/When Recall Condition was Corrected in Production : The improved wiper arm connecting rod will be implemented in production from October 16, 2024.

Recall Schedule :

Description of Recall Schedule :	Customer will be notified by registered mail and customer app while dealers through Lamborghini dealer portal.
Planned Dealer Notification Date :	DEC 06, 2024 - DEC 06, 2024
Planned Owner Notification Date :	DEC 08, 2024 - DEC 13, 2024

\* NR - Not Reported