

Part 573 Safety Recall Report

24E-105

Manufacturer Name : Dicor Corporation

Submission Date : DEC 17, 2024

NHTSA Recall No. : 24E-105

Manufacturer Recall No. : NR



Manufacturer Information :

Manufacturer Name : Dicor Corporation

Address : 2965 Lavanture Place

ELKHART IN 46514

Company phone : 5742662699

Population :

Number of potentially involved : 876

Estimated percentage with defect : 100 %

Equipment Information :

Brand / Trade 1 : InVision

Model : 410-2030 Three Burner Cooktop

Part No. : 410-2030

Size : NR

Function : NR

Descriptive Information : The recall population includes all production of the 410-2030 cooktop between the serial numbers 24000001 and 24001498.

Production Dates : JUN 24, 2024 - JUL 24, 2024

Description of Defect :

Description of the Defect : The center internal aluminum burner tube connecting the gas valve to the cook top burner is fractured.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The burner tube crack could result in a leak of propane when the center burner gas valve is opened to use the appliance. If ignited the propane could result in a fire and/or explosion which could result in personal injury.

Description of the Cause : During manufacture of the center burner tube, it was bent excessively resulting in a fracture of the tube.

Identification of Any Warning that can Occur : The owner could experience the following as an indicator of the defect: 1)The owner could possibly hear a louder than normal hissing sound or smell propane odor when the cooktop gas valve is turned to the "on" position. 2)The flame height could seem lower than normal.3) There could be a flash and whooshing sound when igniting the burner. 4)The control knob of the cooktop could appear to be loose and become difficult to operate.

Involved Components :

Component Name : Burner Tube

Component Description : Aluminum Burner Tube

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : Zhongshan Elitte Electrical Appliance Co

Address : Xihuang 1st ROad
Zhongshan, Guangdong Foreign States

Country : China

Chronology :

NR

Description of Remedy :

Description of Remedy Program : The remedy is to replace the defective center burner tube per the InVision Service Guide.

How Remedy Component Differs from Recalled Component : A mark has been made next to the serial number on the data plate for remedied units.

Identify How/When Recall Condition was Corrected in Production : All inventory on hand was remedied and marked. This occurred the week of December 16, 2024.

Recall Schedule :

Description of Recall Schedule : As an vehicle equipment supplier, InVision will notify the purchasers of this product by letter when approved by NHTSA.

Planned Dealer Notification Date : JAN 15, 2025 - JAN 15, 2025

Planned Owner Notification Date : JAN 15, 2025 - JAN 15, 2025

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR

Address : NR

NR

Country : NR

Company Phone : NR

* NR - Not Reported