Part 573 Safety Recall Report

Manufacturer Name: Daimler Trucks North America, LLC Submission Date : JAN 30, 2025 NHTSA Recall No.: 25V-046 Manufacturer Recall No.: F1017

Manufacturer Information :

Manufacturer Name: Daimler Trucks North America, LLC Address: 4747 N. Channel Avenue Portland OR 97217-3849 Company phone : 800-745-8000

Vehicle Information :

Vehicle 1: 2	020_2025 Froid			1
	020-2025 FIEIgi	ntliner eCascad	lia	
Vehicle Type : B	BUSES, MEDIUM	& HEAVY VEHI	CLES	
Body Style : O	THER			
Power Train : H	IYBRID ELECTRI	С		
2 v r	A defect, which relates to motor vehicle safety, exists in certain Model Year 2020 – 2025 Freightliner eCascadia and Model Year 2022-2026 eM2 vehicles. The affected vehicles are equipped with Electric Vehicle Power Distribution Module (EVDM). The recall population consists of vehicles manufactured from the start of production through January 2025, when the updated EVDM was fully implemented in production.			
Production Dates : A	UG 11, 2020 - JA	N 13, 2025		
VIN Range 1: Be	egin :	NR	End: NR	Not sequential
Vehicle 2: 2 Vehicle Type: B Body Style: O Power Train: H	OTHER	& HEAVY VEHI	CLES	
2 v r	A defect, which relates to motor vehicle safety, exists in certain Model Year 2020 – 2025 Freightliner eCascadia and Model Year 2022-2026 eM2 vehicles. The affected vehicles are equipped with Electric Vehicle Power Distribution Module (EVDM). The recall population consists of vehicles manufactured from the start of production through January 2025, when the updated EVDM was fully implemented in production.			
Production Dates : A	APR 12, 2021 - JA	N 16, 2025		
VIN Range 1: Be	egin :	NR	End: NR	☐ Not sequential

Population :

Number of potentially involved : 810 Estimated percentage with defect : 1%

🖈 🛝 📩 😡

NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION

25V-046

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

25V-046

Page 2

Description of Defect :

Description of the Defect :	A defect, which relates to motor vehicle safety, exists in certain Model Year 2020-2025 Freightliner eCascadia and Model Year 2022-2026 eM2 vehicles. The affected vehicles are equipped with Electric Vehicle Power Distribution Module (EVDM) where the connector plate assembly may pull away from and eventually separate from the housing, causing the pins to disconnect from one or more circuits.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	The effects of the EVDM connector plate separating from the housing depend upon the circuit(s) that become disconnected. In the worst case, this may result in a loss of motive power to the vehicle without advanced warning, increasing the risk of a crash.
Description of the Cause :	NR
<i>v v</i>	Depending on the circumstances and the circuit(s) that become disconnected, in some instances the driver may notice several instrument cluster messages and telltale lamps before the vehicle loses power.

Involved Components :

(

Component Name 1:	EVDM
Component Description :	Electric Vehicle Power Distribution Module
Component Part Number :	A66-30613-000

Component Name 2 :	EVDM
Component Description :	Electric Vehicle Power Distribution Module
Component Part Number :	A66-35242-000

Supplier Identification :

Component Manufacturer

Name :PKC GroupAddress :27500 Drake Rd Suite 250
Farmington Hills Michigan 48331Country :United States

The information contained in this report was submitted pursuant to 49 CFR \$573

Part 573 Safety Recall Report

Chronology : Refer to attached chronology. Description of Remedy : Description of Remedy Program: Description of Remedy Program: Now Remedy Component Differs from Recalled Component: Identify How/When Recall Condition was Corrected in Production: Recall Schedule :

Description of Recall Schedule :	Customer notification will be made by first class mail using Daimler
	Trucks North America records to determine the customers affected.
Planned Dealer Notification Date :	FEB 19, 2025 - FEB 19, 2025
Planned Owner Notification Date :	MAR 31, 2025 - MAR 31, 2025

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573