1

Part 573 Safety Recall Report

Manufacturer Name : Key Safety Systems, Inc. - (DBA Joyson) Submission Date : FEB 21, 2025 NHTSA Recall No.: 25E-013 Manufacturer Recall No.: NR



Number of potentially involved :

Estimated percentage with defect : 100 %

25E-013

Manufacturer Information :

Manufacturer Name : Key Safety Systems, Inc. - (DBA Joyson) Address: 2025 Harmon Road Auburn Hills MI 48326 Company phone: 475 6111

Equipment Information :

Brand / Trade 1:	Head Curtain Airbag
Model :	ACI Gen1
Part No. :	2009086-3
Size :	NR
Function :	Restraint
Descriptive Information :	Head curtain airbag containing an ACI Gen1 inflator manufactured by Joyson in the same production run as a reported field incident.
Production Dates :	AUG 20, 2018 - AUG 21, 2018

Population :

Description of Defect :

Description of the Defect :	The ignition holder of the head curtain airbag may detach during deployment.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	A detached ignition holder may pose a projectile risk in a vehicle.
Description of the Cause :	JSS continues to investigate root cause but has found elevated moisture in the propellant and reduced propellant densities in parts from the affected production lot.
Identification of Any Warning that can Occur :	

Involved Components :

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

25E-013

Component Name : ACI Gen 1 Inflator

Component Description : NR

Component Part Number: 2549496-AA

Supplier Identification :

Component Manufacturer

Name :Joyson Safety SystemAddress :2025 Harmon roadAuburn Hills Michigan 48326Country :United States

Chronology :

On November 13, 2024, VW recalled vehicles outside of the United States to replace affected head curtain airbags manufactured in a specific production lot following a field report. JSS continued its investigation into the issue and thereafter concluded that parts from the entire inflator production run may be affected. Subsequently, JSS was informed that one vehicle with a potentially affected part may be in the United States. On February 13, 2025, JSS's Product Safety Committee decided to file this report based on the information provided by VW.

Description of Remedy :

Description of Remedy Program :	JSS intends to supply replacement airbag modules to the vehicle manufacturer. Please consult the vehicle manufacturer for additional information about the planned remedy.
5 1	Replacement airbag modules supplied by JSS incorporate inflators manufactured outside of the recalled production run.
5	JSS continues to investigate the root cause of the issue and does not currently have any indication that further production is affected.

Recall Schedule :

Description of Recall Schedule :	Please consult the vehicle manufacturer for information about the recall schedule for notifications.
Planned Dealer Notification Date :	NR - NR
Planned Owner Notification Date :	NR - NR

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name :VolkswagenAddress :3800 Hamiln roadAuburn Hills 48326Country :USCompany Phone :NR

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573