

Part 573 Safety Recall Report

25V-075

Manufacturer Name : Winnebago Industries, Inc.**Submission Date :** FEB 10, 2025**NHTSA Recall No. :** 25V-075**Manufacturer Recall No. :** 195**Manufacturer Information :****Population :**

Manufacturer Name : Winnebago Industries, Inc.

Number of potentially involved : 696

Address : PO BOX 152
605 W. Crystal Lake Rd. Forest City IA
50436

Estimated percentage with defect : 100 %

Company phone : 1-641-585-3535

Vehicle Information :

Vehicle 1 : 2025-2025 Winnebago Vita

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined by identifying the production start date of the new employee and when the internal campaign was initiated.

Production Dates : MAR 01, 2024 - NOV 19, 2024

VIN Range 1 : Begin : NR End : NR ☐ Not sequential

Vehicle 2 : 2025-2025 Winnebago View

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined by identifying the production start date of the new employee and when the internal campaign was initiated.

Production Dates : MAR 01, 2024 - NOV 19, 2024

VIN Range 1 : Begin : NR End : NR ☐ Not sequential

Vehicle 3 : 2025-2025 Winnebago Spirit

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined by identifying the production start date of the new employee and when the internal campaign was initiated.

Production Dates : MAR 01, 2024 - NOV 19, 2024

VIN Range 1 : Begin : NR End : NR ☐ Not sequential

Vehicle 4 : 2025-2025 Winnebago Porto
Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information : The recall population was determined by identifying the production start date of the new employee and when the internal campaign was initiated.

Production Dates : MAR 01, 2024 - NOV 19, 2024

VIN Range 1 : Begin : NR End : NR ☐ Not sequential

Vehicle 5 : 2025-2025 Winnebago Navion
Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information : The recall population was determined by identifying the production start date of the new employee and when the internal campaign was initiated.

Production Dates : MAR 01, 2024 - NOV 19, 2024

VIN Range 1 : Begin : NR End : NR ☐ Not sequential

Vehicle 6 : 2025-2025 Winnebago Minnie Winnie
Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information : The recall population was determined by identifying the production start date of the new employee and when the internal campaign was initiated.

Production Dates : MAR 01, 2024 - NOV 19, 2024

VIN Range 1 : Begin : NR End : NR ☐ Not sequential

Description of Defect :

Description of the Defect : On certain Winnebago vehicles the fasteners for the LP tank mounting brackets may not be torqued properly, which can result in the LP tank becoming loose.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : There is potential the mounting brackets could work loose, and the LP tank could fall (hang on one end) or detach. A fallen or detached LP tank increases the risk of an injury or crash.

Description of the Cause : Production did not follow proper procedure when installing the mounting brackets.

Identification of Any Warning NR
that can Occur :

Involved Components :

Component Name 1 : Mounting Assembly

Component Description : Mounting Assembly

Component Part Number : 336248-01-CHT

Supplier Identification :

Component Manufacturer

Name : Winnebago Industries, Inc.

Address : 605 W. Crystal Lake Rd
Forest City 50436

Country : NR

Chronology :

In mid-November, Product Safety was notified of a claim involving a LP tank mounting bracket coming loose on delivery to a dealership. An investigation was subsequently opened, and a campus hold was initiated on 11/20/2024. During the investigation, an audit of 392 units on campus were checked with 6 units having loose fasteners. A process audit determined that production wasn't performing the proper torque to the LP tank mounting assembly. The Product Safety Committee met February 3, 2025 and decided the issue presented an unreasonable risk to safety and a recall was initiated.

Winnebago is aware of 1 claim, 0 injuries, and no property damage as a result of this condition.

Description of Remedy :

Description of Remedy Program : Reimbursement requests will follow the general reimbursement plan on file with NHTSA.

How Remedy Component Differs from Recalled Component : The remedy will involve inspection and, if necessary, applying the proper torque to the LP tank mounting assemblies.

Identify How/When Recall Condition was Corrected in Production : Production has been provided additional training and the workstation procedure has been updated to ensure the proper mounting assembly procedure is followed.

Recall Schedule :

Description of Recall Schedule :	Recall notifications will follow the 60 day requirement.
Planned Dealer Notification Date :	FEB 28, 2025 - FEB 28, 2025
Planned Owner Notification Date :	APR 10, 2025 - APR 10, 2025

* NR - Not Reported