# Part 573 Safety Recall Report

# Manufacturer Name :Nova Bus (US) Inc.Submission Date :FEB 17, 2025NHTSA Recall No. :25V-101Manufacturer Recall No. :CR5691

## **Manufacturer Information :**

**Vehicle Information :** 

Manufacturer Name : Nova Bus (US) Inc. Address : 260 Banker Road PLATTSBURGH NY 12901 Company phone : 450-472-6410

# **Population :**

Number of potentially involved :7Estimated percentage with defect :100 %

### Vehicle 1 : 2005-2008 Nova Bus LFS Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES Body Style : OTHER

Douy Style.	OTHER
Power Train :	DIESEL
Descriptive Information :	The recall population is defined by vehicles built from 2005-11-25 through 2007-11-12, with a configuration of 40 seats or more manufactured with an incorrect amount of emergency exits to meet the requirements of FMVSS 217 S5.2.2.1. While exceeding the unobstructed opening surface required, the impacted vehicle do not provide at least 40% of the required area on each side of the bus.
Production Dates :	NOV 25, 2005 - NOV 12, 2007
VIN Range 1:	Begin : 2NVYL82VX53000221 End : 2NVYL82U383000010 🗸 Not sequential

#### **Description of Noncompliance :**

	Vehicles with 40 seats or more may have been built with an incorrect amount of emergency exits to meet the requirements of FMVSS 217 S5.2.2.1. While exceeding the unobstructed opening surface required, the impacted vehicle do not provide at least 40% of the required area on each side of the bus.
FMVSS 1 :	217 - Bus emergency exits and window retention and release
FMVSS 2 :	NR
Description of the Safety Risk :	During an emergency, a non-compliance to FMVSS 217 S5.2.2.1 may increase the time required to exit the bus, therefore increasing the risk of injury.
Description of the Cause :	Incorrect amount of emergency exits included in vehicle design.
Identification of Any Warning that can Occur :	There is no warning prior to occurrence.

#### **Involved Components :**

The information contained in this report was submitted pursuant to 49 CFR §573



25V-101

Component Name 1: Window

Component Description : WDO L SLDR 44% TEMP GREY PO

Component Part Number: NR

#### **Supplier Identification :**

#### **Component Manufacturer**

Name :	Arow Global
Address :	924 North Park View Circle
	Mosinee Wisconsin 54455
Country :	United States

#### **Chronology** :

October 29th, 2024 : Customer Project Manager files a client request to replaced fixed windows by openable windows on buses in service for ventilation purposes.

November 12th, 2024 : Engineering evaluates the request.

November 21st, 2024: Nova Bus engineering notices a potential non-compliance to FVMSS 217 with client bus configuration and informs the safety office.

November 29th, 2024: Nova Bus opens a formal potential safety related issue investigation.

December, 2024 : During the investigation, the safety office team notices a potential non-compliance affecting more vehicles than those of the specific customer. Similar configurations are screened through to identify other potential affected vehicles.

January 16th, 2025: Product Safety Evaluation Committee evaluates the information and decides to raise to Product Safety Committee.

January 21st, 2025: Product Safety Committee requests additional information and clarifications. February 11th, 2025 : Product Safety Committee determination of a non-compliance to FMVSS 217. February 17th, 2025: Nova Bus files 573 with NHTSA that a voluntary recall will be released to address the non-compliance.

There have been no accidents or injuries related to this defect. There have been no warranty claims related to this defect.

The information contained in this report was submitted pursuant to 49 CFR §573

#### **Description of Remedy :**

Description of Remedy Program :	Remedy program is to replace regular windows by emergency exits windows to provide at least 40% of the required emergency exit area on each side of the bus as per FMVSS 217 S5.2.2.1. All costs associated with this corrective measure will be covered by Nova Bus. Pre-notification remedies will be addressed using the Nova Bus general reimbursement plan on file with NHTSA.
	Remedied component will be a window with the emergency exits features. Part numbers will differ for each client.
Identify How/When Recall Condition was Corrected in Production :	No vehicles after $11/12/2007$ were found to have this non-compliance.

#### **Recall Schedule :**

Description of Recall Schedule :	Note: Nova Bus does not have a dealer network and the dates entered for the planned dealer notification begin/end date are only to avoid NHTSA Recall Portal error while submitting the recall report.
Planned Dealer Notification Date : Planned Owner Notification Date :	

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573