

# Part 573 Safety Recall Report

# 25V-135

**Manufacturer Name :** Daimler Vans USA, LLC**Submission Date :** FEB 28, 2025**NHTSA Recall No. :** 25V-135**Manufacturer Recall No. :** VS3HALHAN**Manufacturer Information :**

**Manufacturer Name :** Daimler Vans USA, LLC  
**Address :** One Mercedes-Benz Drive  
 Sandy Springs GA 30328  
**Company phone :** 8777628267

**Population :**

**Number of potentially involved :** 88  
**Estimated percentage with defect :** 100 %

**Vehicle Information :****Vehicle 1 :** 2024-2024 Mercedes-Benz Sprinter**Vehicle Type :****Body Style :** VAN**Power Train :** NR**Descriptive Information :** The recall population was determined through production records.**Production Dates :** DEC 23, 2022 - JUL 17, 2024**VIN Range 1 : Begin :** NR **End :** NR  Not sequential**Description of Noncompliance :**

**Description of the Noncompliance :** Mercedes-Benz AG ("MBAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Sprinter (907 platform) vehicles, certain spot welds that attach the parking brake cable bracket to the underbody frame might not meet current production specifications.

**FMVSS 1 :** 105 - Hydraulic and electric brake systems**FMVSS 2 :** NR

**Description of the Safety Risk :** In this case, the bracket may loosen over time and result in a reduced brake hold force when the parking brake is engaged, which might increase the risk of a crash. Subsequently, the performance requirements of FMVSS 105 S5.2 might not be met.

**Description of the Cause :** Due to a production deviation, certain brackets might not have been welded according to current production specifications.

**Identification of Any Warning that can Occur :** The driver will not receive a warning due to the nature of the failure mechanism.

**Involved Components :**

Component Name 1 : Longitudinal Member Bracket

Component Description : Longitudinal Member Bracket

Component Part Number : A9063102918

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

## Chronology :

Please see attached

## Description of Remedy :

Description of Remedy Program : As a precautionary measure, an authorized Mercedes-Benz Sprinter dealer will check the parking brake bracket on the affected vehicles and rework it, if necessary.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : A change in the production procedure of our supplier ensures that this issue can no longer occur from Sep 14, 2024 onwards.

## Recall Schedule :

Description of Recall Schedule : Dealers will be notified of the pending voluntary recall campaign on March 7, 2025. A copy of all communications will be provided when available. Owners will be notified of the voluntary recall campaign before Apr 25, 2025.

Planned Dealer Notification Date : MAR 07, 2025 - MAR 07, 2025

Planned Owner Notification Date : APR 25, 2025 - APR 25, 2025

\* NR - Not Reported