OMB Control No.: 2127-0004

云 🔨 🗛 🖈

Number of potentially involved : 199 Estimated percentage with defect : 8 %

**Population :** 

NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION

# Part 573 Safety Recall Report

Manufacturer Name :Nissan North America, Inc.Submission Date :MAR 11, 2025NHTSA Recall No. :25V-153Manufacturer Recall No. :PMA45

## Manufacturer Information :

Manufacturer Name : Nissan North America, Inc. Address : P. O. BOX 685001 Franklin TN 37068-5009 Company phone : 800-647-7261

## Vehicle Information :

Vehicle 1:	2025-2025 Nissan Sentra	
Vehicle Type :	LIGHT VEHICLES	
Body Style :	4-DOOR	
Power Train :	GAS	
Descriptive Information :	Based on Nissan production records, the issue in Section 5 below) is specific to Nissan Sentra vehicles that were equipped with an affected manual driver's seat assembly and produced during the specified vehicle production period. No other Nissan or INFINITI vehicles are affected.	
Production Dates :	FEB 08, 2025 - FEB 14, 2025	
VIN Range 1:	Begin : NR End : NR Not sequential	

## **Description of Noncompliance :**

-	On affected Sentra vehicles, the driver's seat may not be fully secured to the outboard seat track due to a poor weld condition from the supplier. This condition may not meet the requirements of Federal Motor Vehicle Standard (FMVSS) 207 S4.2.1 "Seat Adjustment," FMVSS 207 S4.3.2 "Performance of Restraining Device," and FMVSS 210 S5.1 "Seats with Type 1 or Certain Type 2 Seat Belt Assemblies."
FMVSS 1 :	207 - Seating systems
FMVSS 2 :	210 - Seat belt assembly anchorages
Description of the Safety Risk :	If this condition occurs there is an increased risk of injury to the occupant in the event of a crash.
Description of the Cause :	NR
5 0	In this case, the driver may notice an abnormal noise and, or abnormal movement from an affected seat assembly.

#### The information contained in this report was submitted pursuant to 49 CFR §573

## Part 573 Safety Recall Report

25V-153

#### **Involved Components :**

Component Name 1: FRAME ASSY-CUSHION, FRONT SEAT

Component Description : Driver's Seat Cushion

Component Part Number: 87151 6LB0A

#### **Supplier Identification :**

#### **Component Manufacturer**

Name : Forvia Sistemas Automotrices

Address : Avenue Central No. 200

Interior 365 Parque Logistico San Luis Foreign States 78395

Country: Mexico

#### **Chronology** :

See attached Part 573 for Chronology details.

#### **Description of Remedy :**

Description of Remedy Program :	Dealers will inspect the driver's side seat frame to determine whether the seat contains a suspect serial part number. Once the seat assembly is confirmed as a suspect part with Nissan, the dealer will be instructed to replace the driver's side lower seat frame assembly. All inspections and repairs will be performed free of charge for parts and labor and may take up to one and a half (1.5) hours to complete. Nissan will not include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy as the subject vehicles are under warranty.
How Remedy Component Differs from Recalled Component :	NR
Identify How/When Recall Condition was Corrected in Production :	NR

#### **Recall Schedule :**

The information contained in this report was submitted pursuant to 49 CFR §573

Description of Recall Schedule :	
	Dealers were notified of the recall on March 6, 2025. Owners of all potentially affected vehicles will be notified beginning May 1, 2025.
Planned Dealer Notification Date :	MAR 11, 2025 - NR
Planned Owner Notification Date :	MAY 01, 2025 - NR

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573