

# Part 573 Safety Recall Report

## 25V-301

**Manufacturer Name :** Thor Motor Coach**Submission Date :** MAY 08, 2025**NHTSA Recall No. :** 25V-301**Manufacturer Recall No. :** RC000326**Manufacturer Information :****Population :**

Manufacturer Name : Thor Motor Coach

Number of potentially involved : 42

Address : PO Box 1486

Estimated percentage with defect : 100 %

701 County Road 15 Elkhart IN 46515

Company phone : 877-500-1020

**Vehicle Information :**

Vehicle 1 : 2025-2026 Thor Motor Coach Outlaw

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Morryde recall 25E026

Production Dates : MAY 30, 2024 - APR 23, 2025

VIN Range 1 : Begin :

NR

End : NR

☐ Not sequential**Description of Defect :**

Description of the Defect : Morryde recall 25E026 determined the bracket mounting bolts for the removable step did not have the locking fluid to retain the assembly. The bracket may come loose, which can cause the steps to detach.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the bracket becomes loose while being used, it can separate allowing the step assembly to fall. Steps that detach while in use increase the risk of injury.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Involved Components :**

Component Name 1 : Clipon bracket

Component Description : Clipon bracket

Component Part Number : THP56-143

### Supplier Identification :

#### Component Manufacturer

Name : Morryde International

Address : 1966 Sterling Ave  
Elkhart Indiana 46516

Country : United States

### Chronology :

On April 24, 2025 Morryde sales representative informed TMC of their recall. April 25, 2025, Morryde repaired all units on TMC campus. On May 7, 2025, TMC was able to identify all units with the recalled bracket. No warranty, customer complaints, or incidents claims have been documented.

### Description of Remedy :

Description of Remedy Program : The remedy is to replace the step bracket with a properly built bracket. All repairs will be completed at no cost to the owner. Reimbursement will follow the general reimbursmeent plan that is on file with NHTSA.

How Remedy Component Differs from Recalled Component : The repaired units will have a bracket installed using thread locking compound to prevent the bracket from coming loose.

Identify How/When Recall Condition was Corrected in Production : Morryde repaired units on the production assembly line and provided the properly built brackets for new production units being inserted on the assembly line.

### Recall Schedule :

Description of Recall Schedule : Thor Motor Coach has the utmost urgency in notifying owners about a recall that affects their vehicle. Letters will be sent out once all pertinent information has been gathered.

Planned Dealer Notification Date : JUL 07, 2025 - JUL 07, 2025

Planned Owner Notification Date : JUL 07, 2025 - JUL 07, 2025

\* NR - Not Reported