



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V323

Manufacturer Name: International Motors, LLC

Submission Date: May 15, 2025

NHTSA Recall No.: 25V323

Manufacturer Recall No.: 25506

Manufacturer Information

Population

Manufacturer Name: International Motors, LLC

Address: 2701 Navistar Drive
Lisle IL, 60532

Total number of potentially involved: 7

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2025-2026 IC Bus CESB

Product Category: Buses, Medium & Heavy Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Oct 28, 2024 - Apr 15, 2025

Number of potentially involved:

Descriptive Information:

- The suspect population was identified by certain vehicles built 10/28/2024 thru 4/15/2025 with a wheelchair lift, Intellipark Electronic Park Brake (feature code 004GBL) and without wheelchair tie downs.
- The vehicles in the suspect population were identified by their build dates and configurations: Any wheelchair lifts, Intellipark Electronic Park Brake (feature code 004GBL) and without wheelchair tie downs. All other similar vehicles, which are not subject to this recall, are excluded.

Defect / Noncompliance Description

Description of the defect or noncompliance:

On certain buses built with a wheelchair lift and Intellipark parking brake system, the parking brakes can be released allowing the vehicle to move when the wheelchair lift is deployed. These vehicles do not meet FMVSS-403 S6.10.2.1 Interlocks.

S6.10 Interlocks.

S6.10.2 The platform lift system must have interlocks or operate in such a manner when installed according to the installation instructions, as to prevent:

- S6.10.2.1 Forward or rearward mobility of the vehicle unless the platform lift is stowed. The design of this system must be such that it discourages accidental release and does not affect vehicle movement when the lift is stowed until the vehicle is stopped and the lift deployed. Verification with this requirement is made throughout the lift operations specified in S7.9.2 and S7.9.3.

Part 573 Safety Recall Report

25V323

FMVSS1: 403 - Platform lift systems

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

- A bus that can move when the wheelchair lift is deployed may increase the risk of injury.

Description of the cause:

Identification of any warning that can occur:

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name:

Address:

Country:

Involved Components

Component Name 1: CONTROL

Component Description: CONTROL, BRAKE VALVES

Component Part Number: 4390200C3

Chronology

04/16/2025: During a Pre-Delivery Inspection at the Tulsa Assembly Plant, an inspector found that the park brake could release while performing the wheelchair lift operation. 04/21/2025: International begins production with corrected programming and establishes the clean point at the IC Bus Tulsa Bus Assembly Plant. 04/29/2025: International Engineering, Field Service, and Product Safety Office meet to review the potential concern of park brake releasing while performing a lift operation. 05/02/2025: International Engineering, Product Compliance, and Product Safety Office meet to review the failure mode and its effect on the vehicle and initiates study to understand configurations of potential suspect vehicles. 05/07/2025: International finalizes suspect population. 05/08/2025: International declares a noncompliance recall.

Part 573 Safety Recall Report

25V323**Related NHTSA Recall Number:**

Description of Remedy

Remedy Type:**Consumer Advisories:** ☐ Do Not Drive ☐ Park Outside**Description of remedy program:**

- Replace the dash electronic control unit (DECU) module.
- International's plan for reimbursement of pre-notification remedies, on file with NHTSA and dated 06/07/2024 applies and reimbursement instructions will be included in the customer notification.

How remedy component differs from recalled component:

NA

Identify how/when recall condition was corrected in production:

- See chronology.

Reimbursement Plan

Description of reimbursement program:**Period of reimbursement:****Costs to be reimbursed:****Address for reimbursement claims:**

Recall Schedule

Description of recall schedule:

- When parts are available, remedy instructions and owner notifications will be distributed. Tentative schedule as indicated.

Planned Dealer Notification Date: Jun 30, 2025 - Jun 30, 2025☐ No Dealers**Planned Interim Owner Notification Date:**☐ No Owners

Part 573 Safety Recall Report**25V323****Planned Remedy Owner Notification Date:** Jul 07, 2025 - Jul 08, 2025☐ Phased Recall**Date when VIN will be searchable:**