



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V492

Manufacturer Name: Porsche Cars North America, Inc.

Submission Date: Jul 28, 2025

NHTSA Recall No.: 25V492

Manufacturer Recall No.: ASA7

Manufacturer Information

Population

Manufacturer Name: Porsche Cars North America, Inc.

Address: One Porsche Drive
Atlanta GA, 30354

Total number of potentially involved: 3

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2024-2024 PORSCHE MACAN 4 ELECTRIC

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion: Electric Battery Power

Production Dates: Aug 02, 2024 - Aug 13, 2024

Number of potentially involved: 2

Descriptive Information:

The recall population was determined by production records.

Vehicle 2: 2025-2025 PORSCHE MACAN 4 ELECTRIC

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion: Electric Battery Power

Production Dates: Apr 15, 2025 - Apr 15, 2025

Number of potentially involved: 1

Descriptive Information:

The recall population was determined by production records.

Part 573 Safety Recall Report

25V492

Defect / Noncompliance Description

Description of the defect or noncompliance:

Due to an assembly deviation, the front seat airbags may not be correctly fastened to the backrest frame in certain vehicles.

FMVSS1:**FMVSS2:****Description of the safety risk, including crash, fire, death, injury:**

In cases where the front seat airbags are not correctly fastened, proper deployment and positioning of the airbag in the event of a crash cannot be ensured. Additionally, there is a potential risk to occupant safety resulting from loose components. Both issues increase the risk of injury to vehicle occupants.

Description of the cause:

The operator inserted the screw directly into the frame without first guiding it through the designated eyelet on the airbag housing. As a result, the respective airbag is only partially engaged at the top section of the frame.

Identification of any warning that can occur:

There is no warning.

Component Manufacturer

Tier of Supplier:**Supplier Type:****Name:** Adient Czech Republic s.r.o.**Address:** Kratochvílova 2657
Jelcz-Laskowice Foreign States, 413 01**Country:** Czech Republic

Involved Components

Component Name 1: Front Seat Airbag**Component Description:** The front seat airbags, integrated into the seat, are designed to protect occupants during side collisions. It is integrated in the seat backrest frame.**Component Part Number:** 95C880241*/2*

Part 573 Safety Recall Report

25V492

Component Name 2: Front Seat Airbag

Component Description: The front seat airbags, integrated into the seat, are designed to protect occupants during side collisions. It is integrated in the seat backrest frame.

Component Part Number: 95C880581*/2*

Chronology

July 11 – The issue was officially reported and registered for further investigation internally.

July 14 – A technical pre-evaluation of the reported issue was conducted to assess its relevance and potential impact.

July 15 – Experimental testing was commenced to validate the suspected deviation.

Subsequently – Initial test results were obtained and presented. These results indicated a negative outcome regarding proper airbag deployment.

Following this – Further analysis of the issue was carried out, including the identification of potentially affected vehicles.

On July 23, 2025 – the case was presented to Porsche's safety evaluation committee. Some of the Airbag tests conducted have demonstrated that the restraining effect is no longer guaranteed due to the incorrect positioning of the airbag.

A safety defect was determined in the identified vehicles, and a recall decision was made.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type:

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Screw connection of the airbag bracket to the seat frame must be checked and, if necessary, reworked to ensure proper airbag mounting according to specifications.

The owner's letter will not include a statement about customer reimbursement for pre-notification remedies as all the affected vehicles are still covered under Porsche New Car Limited Warranty.

How remedy component differs from recalled component:

No component will be replaced during the remedial measure, only the screw connection of the airbag bracket is checked and reworked.

Identify how/when recall condition was corrected in production:

Part 573 Safety Recall Report

25V492

Adjusting of the parameter for the fastening screw on June 30th, 2025.

Reimbursement Plan

Description of reimbursement program:

Period of reimbursement:

Costs to be reimbursed:

Address for reimbursement claims:

Recall Schedule

Description of recall schedule:

Owners will be notified within 60 days of the filing of this report.

Planned Dealer Notification Date:

☐ No Dealers

Planned Interim Owner Notification Date:

☐ No Owners

Planned Remedy Owner Notification Date:

☐ Phased Recall

Date when VIN will be searchable: Aug 14, 2025