



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

## 25V531

**Manufacturer Name:** Triumph Motorcycles America, Ltd.

**Submission Date:** Aug 19, 2025

**NHTSA Recall No.:** 25V531

**Manufacturer Recall No.:** SRAN 640

### Manufacturer Information

### Population

**Manufacturer Name:** Triumph Motorcycles  
America, Ltd.

**Address:** 100 Hartsfield Centre  
Parkway  
Suite 200  
Atlanta GA, 30354

**Total number of potentially involved:** 1,929

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2024-2025 TRIUMPH DAYTONA 660

**Product Category:** Motorcycles

**Product Type:** Motorcycles

**Fuel / Propulsion:** Spark Ignition Fuel

**Production Dates:** Jan 02, 2024 - Dec 02, 2024

**Number of potentially involved:** 1,929

**Descriptive Information:**

The recall population was based upon a review of factory records.

### Defect / Noncompliance Description

**Description of the defect or noncompliance:**

Engine damage, including deterioration and complete loss of functionality.

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

The engine may degrade prematurely due to internal damage. In extreme cases, this could increase the risk of a crash, especially during high-demand driving conditions.

# Part 573 Safety Recall Report

# 25V531

## Description of the cause:

The root cause is insufficient lubrication within the crankshaft / bearing. This is triggered by air entering the oil system due to sloshing during aggressive deceleration, which causes pressure drops and disrupts oil flow.

## Identification of any warning that can occur:

No warnings.

## Component Manufacturer

**Tier of Supplier:**

**Supplier Type:**

**Name:**

**Address:**

**Country:**

## Involved Components

**Component Name 1:**

**Component Description:**

**Component Part Number:**

## Chronology

17/7/24: First warranty claim received.

12/12/24: Date of SPD raised

12/12/24: Date 8D raised

12/8/25: Recall decision made.

-----  
0 x Fatalities.

0 x Injuries.

13 x Consumer Complaints.

27 x Field Reports.

18 X Warranty Claims

# Part 573 Safety Recall Report

**25V531****Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:** Repair**Consumer Advisories:** ☐ Do Not Drive ☐ Park Outside**Description of remedy program:**

Triumph Motorcycle dealers will increase the engine oil capacity and install a redesigned dipstick to ensure accurate oil level measurement.

Pursuant to 49 CFR §577.11(e), Triumph requests that it be exempt from providing notification of a reimbursement plan. Any pre-notification product failure would have been addressed under the manufacturer's limited warranty. Accordingly, no person would be eligible for reimbursement pursuant to §573.13.

**How remedy component differs from recalled component:**

In controlled testing, the defect was consistently reproduced under specific conditions. However, when oil levels were increased as per the remedy, the issue was fully mitigated—no pressure drops were observed, and engine performance remained stable.

**Identify how/when recall condition was corrected in production:**

Complete VIN range affected until end of production.

## Reimbursement Plan

**Description of reimbursement program:****Period of reimbursement:****Costs to be reimbursed:****Address for reimbursement claims:**

## Recall Schedule

**Description of recall schedule:**

The planned dates are an estimate and may be revised.

**Part 573 Safety Recall Report****25V531****Planned Dealer Notification Date:** Sep 14, 2025 - Sep 14, 2025☐ No Dealers**Planned Interim Owner Notification Date:**☐ No Owners**Planned Remedy Owner Notification Date:** Sep 17, 2025 - Sep 17, 2025☐ Phased Recall**Date when VIN will be searchable:** Sep 14, 2025